

## **CONDITION REPORT - INTERNAL COMBUSTION**

Manufacturer	Model Ye	ear	Serial Number	
YALE MANUFACTURER	GC040VX 20	012	A910V22101L	
Mast	3 Stage FFL (Triplex)		Hours	na Meter inoperable
Mast Height Lowered			Fuel	LP Gas
Mast Height Raised			Attachment	Other
Hydraulic Control Valve	4-Function		Directional Control	Lever
Capacity			Tires	
Mast Condition	Not applicable		Engine	Mazda
Mast Comments	Shims missing		Engine Inspected Condition	Will not start
Lift Cylinder Condition			Engine Inspected Comments	
Lift Cylinder Comments			Radiator Condition	
Tilt Cylinder Condition	Bent		Radiator Comments	
Tilt Cylinder Comments	left cyl broken		Transmission/MDU Condition	
Carriage Condition			Transmission/MDU Comments	
Carriage Comments				
Load Backrest Condition			Steering Pump Condition	
Load Backrest Comments			Steering Pump Comments	
Forks Condition	Bent / warped / damaged		Hydraulic Pump Condition	
Forks Comments	worn out		Hydraulic Pump Comments	
			Hydraulic Motor Condition	
Overhead Guard Condition	Damaged		Hydraulic Motor Comments	
Overhead Guard Comments	Bent		Control System Condition	
			Control System Comments	
Seat Condition	Damaged			
Seat Comments	needs seat		Differential Condition	
			Differential Comments	
General Appearance Condition			Drive Tires % Remaining	20
General Appearance Comments			Drive Tires Condition	Chunked
• • • • • • • • • • • • • • • • • • • •			Steer Tires % Remaining	30
General Comments			Steer Tires Condition	Chunked
	tiple repairs. This truck appears to have been sitting here	re for sometime. I	Steer Axle Condition	
cant list anymore than I have because it do	oes not run. Wire harness completely melted/ lp lock of	ff melted. Vehicle	Steer Axle Comments	
had a fire. Let us know how to proceed wi	ith this. Electrical system unknown. This could possibly o		Brakes Condition	
2000.00-3000.00 to try to get it to running	condition to see if there is further damage.		Brakes Comments	
			Electrical Condition	
			Electrical Comments	

Inspector Company Name	LIFTONE	Inspection Date	4/15/2019 12:48:17 PM	$\Box$
Inspector Name	ljames			



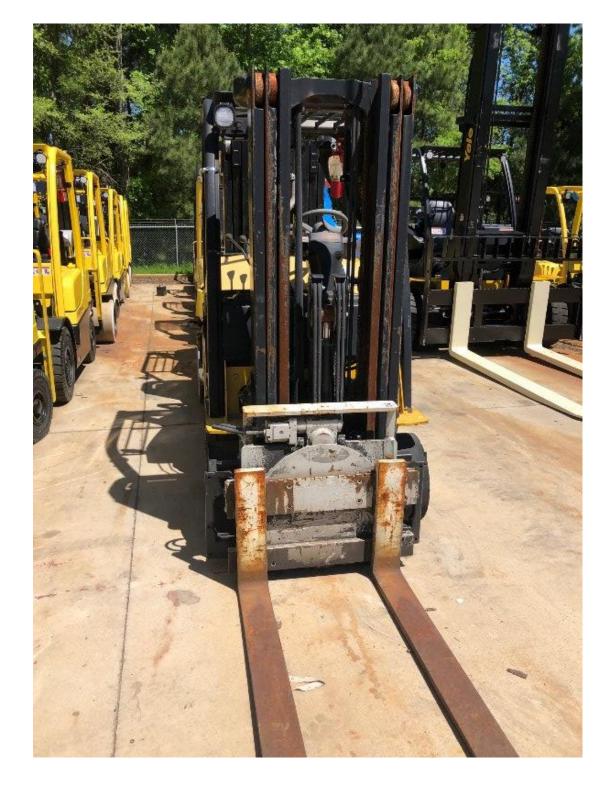

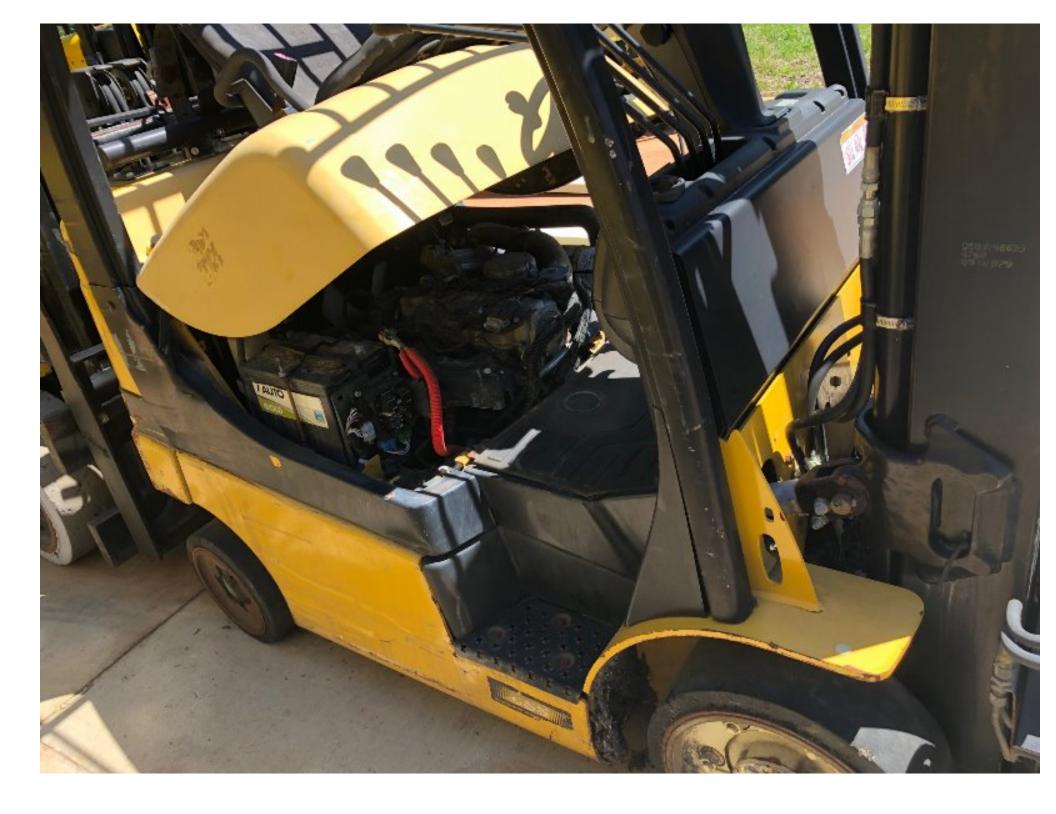



## Lift Truck Model GLC040VXNVSE083 Serial No. A910V22101L

Attachment: 978 mm (38.5 in) SS Crg + Cascade Rotator R30E-RRB.

Truck Weight 3890 kg (8570 lb) Tread Width 890 mm (35.1 in)

Back Tilt 5.0 Degrees

Front Size

21X7X15 Cushion Pressure

Rear

	CAPAIMUM			wear	
	CAPACITY	Load Height		16X5X10.5	
ST	1360 1	Dim. A	Load		Cushio
NN	(2000 lp)	4800m	Dim. B	Center	7.
	0 kg (0 lb)	(109 in)	610 mm	Dim. C	181
	10)	0 nen	(eq in)	610 mm	17-
			0 mm	(24 in)	1 7

